



SERVICE BULLETIN # 117

WARNING!!!!

THIS SERVICE BULLETIN ADDRESSES SAFETY RELATED INFORMATION. FAILURE TO COMPLY WITH THESE REQUIREMENTS CAN RESULT IN DEATH OR SERIOUS INJURY

DATE: August 26, 2005

TO: Time Export

SUBJECT: Knuckle Repair

THE PROBLEM:

Time Manufacturing has received reports of a crack appearing at the knuckle mounting support where the master leveling cylinder is attached. Please reference drawing, #32746, on the second page.

UNITS AFFECTED:

All SST-36NE's, ENH's and EIH's with the two (2) man bucket option rated at 200 KG's.

SOLUTION:


All targeted units must be identified, located, and inspected to determine if a crack is present at the affected area. If a crack is found, stop-drill the ends of the crack with a 1/8"–3/16" drill bit, v-groove the crack, weld with 7018 electrode or equivalent wire and grind smooth. At this point, add the support bracket, welding as detailed in the drawing. Paint as needed. Should the inspection reveal no evidence of a crack, the support bracket must still be installed. The bracket can be ordered by requesting part number MO-277-1.

WHAT TIME MANUFACTURING WILL DO:

The machines in question have exceeded the warranty period. However, to ensure the safety of our customers and the continual safe operation of our machines we will provide the parts at no cost. In addition, we will issue a credit of two hours (\$80.00) when the Letter of Compliance is returned to Time Manufacturing. The compliance letter may be faxed to 254-399-8463 or mailed to:

Time Manufacturing Company P.O. Box 20368 Waco, Texas 76702-0368

You may also scan the letter and email it to service@timemfg.com

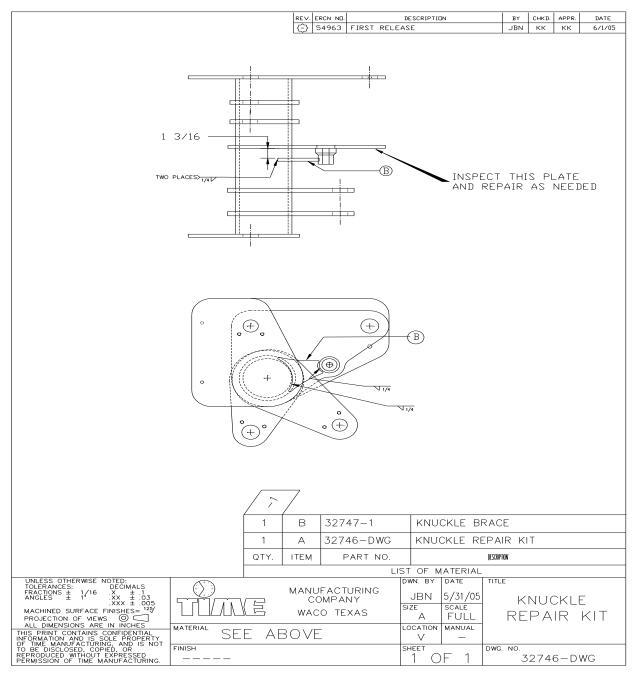

Service Bulletin 117—Letter of Compliance

This is to certify the work described in Service Bulletin #117 has been performed on the following unit.

Model Number		
Serial		
Serial Number		
Work Performed By	Date	

Please fax to 254-399-8463 or Email to service@timemfg.com